

# CAERNARFON BAR BUOYS - Updated 04.03.2010

## IMPORTANT NOTICE TO MARINERS


Mariners are advised that a survey of the Caernarfon Bar channel conducted on 1<sup>st</sup> March 2010 has identified the need to reposition Channel Buoys C1 and C2 to the SSE of their current positions and to reposition Channel Buoy C3 to the WNW of its current position. These buoys will be repositioned as soon as practicable. In the meantime mariners are advised to exercise caution in this area. It is advisable to follow the route shown by the dashed line below (passing to the south of C1 and well to the west of C3).

## NOTE

This chart is for illustration purposes only and is not suitable for navigation.

## DATUM

The datum used for these positions is **WGS 84**.

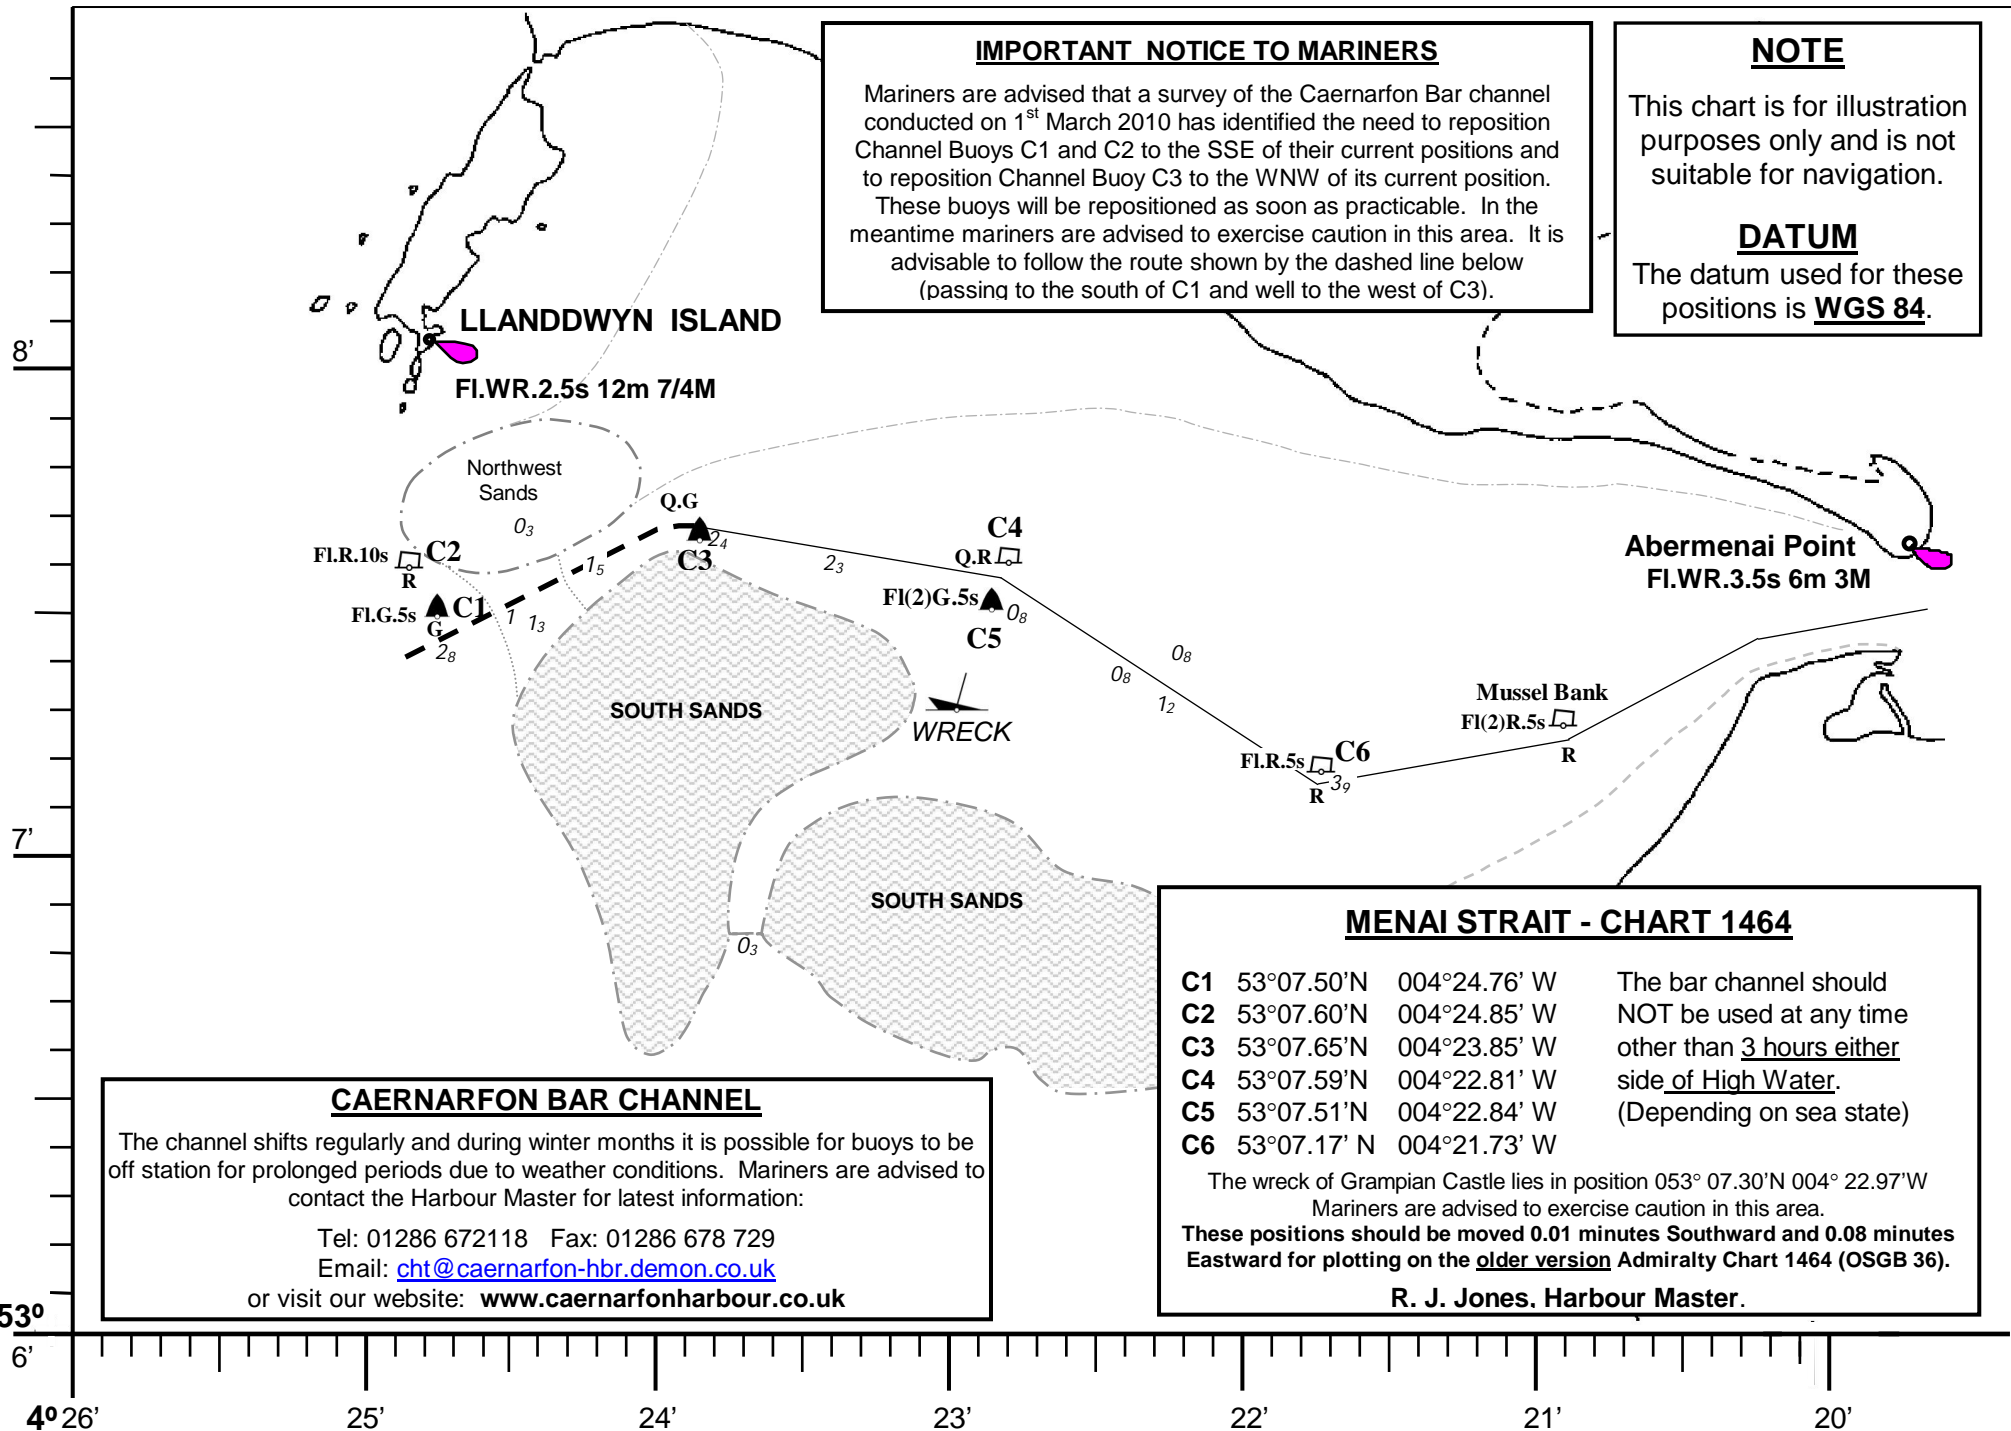

## CAERNARFON BAR CHANNEL

The channel shifts regularly and during winter months it is possible for buoys to be off station for prolonged periods due to weather conditions. Mariners are advised to contact the Harbour Master for latest information:

Tel: 01286 672118 Fax: 01286 678 729

Email: [cht@caernarfon-hbr.demon.co.uk](mailto:cht@caernarfon-hbr.demon.co.uk)

or visit our website: [www.caernarfonharbour.co.uk](http://www.caernarfonharbour.co.uk)

## MENAI STRAIT - CHART 1464

<b>C1</b>	53°07.50'N	004°24.76' W	The bar channel should NOT be used at any time other than <u>3 hours</u> either side of <u>High Water</u> . (Depending on sea state)
<b>C2</b>	53°07.60'N	004°24.85' W	
<b>C3</b>	53°07.65'N	004°23.85' W	
<b>C4</b>	53°07.59'N	004°22.81' W	
<b>C5</b>	53°07.51'N	004°22.84' W	
<b>C6</b>	53°07.17' N	004°21.73' W	

The wreck of Grampian Castle lies in position 053° 07.30'N 004° 22.97'W. Mariners are advised to exercise caution in this area. These positions should be moved 0.01 minutes Southward and 0.08 minutes Eastward for plotting on the older version Admiralty Chart 1464 (OSGB 36).

R. J. Jones, Harbour Master.